




STATE OF NEW YORK
OFFICE OF GENERAL SERVICES
DESIGN AND CONSTRUCTION GROUP
THE GOVERNOR NELSON A. ROCKEFELLER
EMPIRE STATE PLAZA
ALBANY, NY 12242

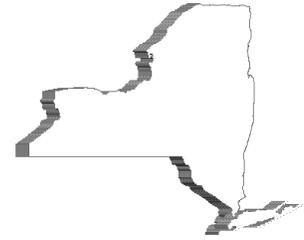

ADDENDUM NO. 2 TO PROJECT NO. 44281

**CONSTRUCTION WORK
REPAIR CONCRETE PERIMETER WALL AND EXTERIOR OF BUILDINGS 9, 10, & 11
SING SING CORRECTIONAL FACILITY
354 HUNTER STREET
OSSINING, NY**

January 23, 2014

NOTE: This Addendum forms a part of the Contract Documents. Insert it in the Project Manual. Acknowledge receipt of this Addendum in the space provided on the Bid Form.

CONSTRUCTION DRAWINGS

1. Drawing No. S-103:
 - a. NORTH ELEVATION, leader note pointing to left side of EXIST. CMU STAIR TOWER:
Change note to "REMOVE ¼' X 5/8' WIDE CEMENTITIOUS COATING, 5/8" WIDE SEALANT AND 5/8' BACKER ROD FROM THE INTERSECTION OF THE EXTERIOR FACE OF THE WEST AND EAST STAIR TOWER CMU WALLS AND THE CONCRETE WALLS OF BLDG. #9, FULL HEIGHT. INSTALL TYPE 1 SEALANT AND BACKER ROD FULL HEIGHT".
 - b. WEST ELEVATION, leader note at left pointing to face of loading dock:
Change note from "APPLY 2" PATCHNG MATERIAL...", to "APPLY AVERAGE OF 2" OF POLYMER MODIFIED REPAIR MORTAR...".
 - c. SOUTH ELEVATION, leader note at left pointing to top of loading dock:
Change beginning of note from "REMOVE EXISTING 6-1/2" CONC. SLAB X100 SF WHERE DAMAGED. ...", to "REMOVE EXISTING 6-1/2" CONC. SLAB X100 SF WHERE DAMAGED, at (4) 25 SF LOCATIONS. ...".
 - d. SOUTH ELEVATION, leader note at left pointing to top of loading dock:
Add to end of note "SLAB IS ELEVATED 3' ABOVE GRADE. ACCESS WILL BE FROM ABOVE SLAB ONLY."
2. Drawing No. S-104:
 - a. WEST ELEVATION:
Add the following note:
"NOTE; 1) UNDERSIDE AND OVERHEAD REPAIRS SHOWN AT THE LOADING DOCK ARE ACCESSIBLE FROM THE FRONT FACE OF THE LOADING DOCK. APPROX. REPAIR HEIGHT = 3' ABOVE GRADE."

3. Drawing No. S-107:
 - a. Detail 9:
Add note 3 to NOTES column:
“3) EXISTING GRADE BELOW THE SLAB VARIES FROM 0” TO 2’-6” BELOW
THE BOTTOM OF THE SLAB.”.

END OF ADDENDUM

James Dirolf, P.E.
Director of Design